

Your solder joints should look like those shown as 'OK' below, they should have that neat conical shape on BOTH sides of the PCB. If they don't look the same on both sides then stop! Work out why from the soldering guides linked and don't continue until you are getting those results. This isn't about perfectionism, you are very likely to end up with a destroyed, damaged or defective unit if you're not hitting that standard.

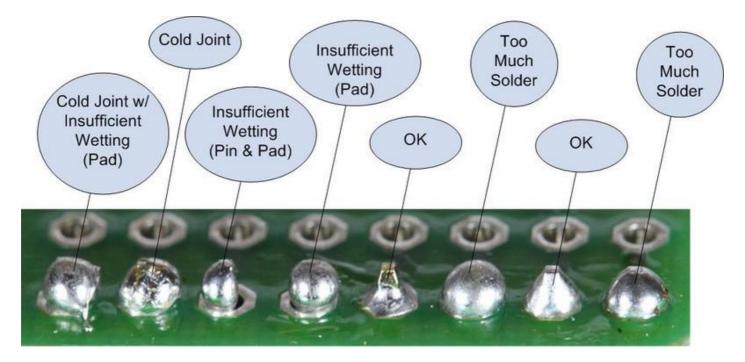


This photo is from the Adafruit guide to excellent soldering - <u>http://bit.ly/1I77tF4</u> and is reproduced under an Attribution-Sharealike creative commons license - <u>http://creativecommons.org/licenses/by-sa/3.0/</u>

Future Sound Systems – Brunswick Build Document V1

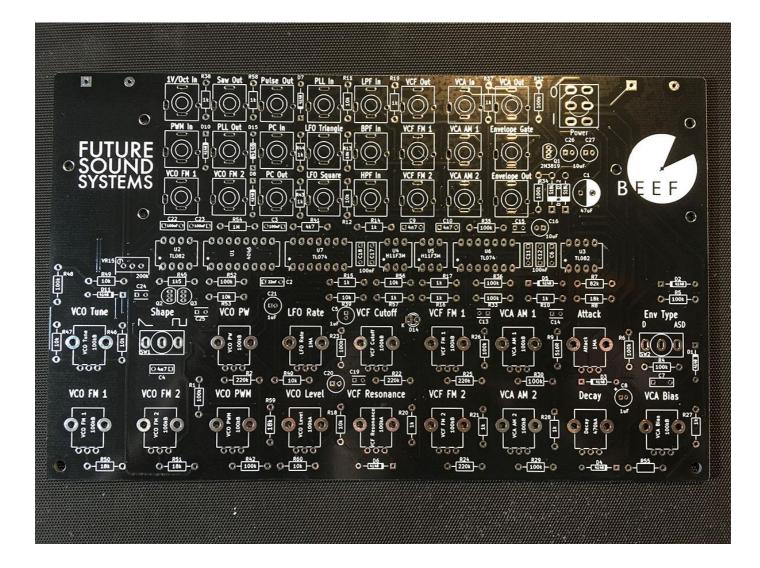


01 - This is the bare Brunswick PCB - familiarise yourself with the layout

Future Sound Systems – Brunswick Build Document V1

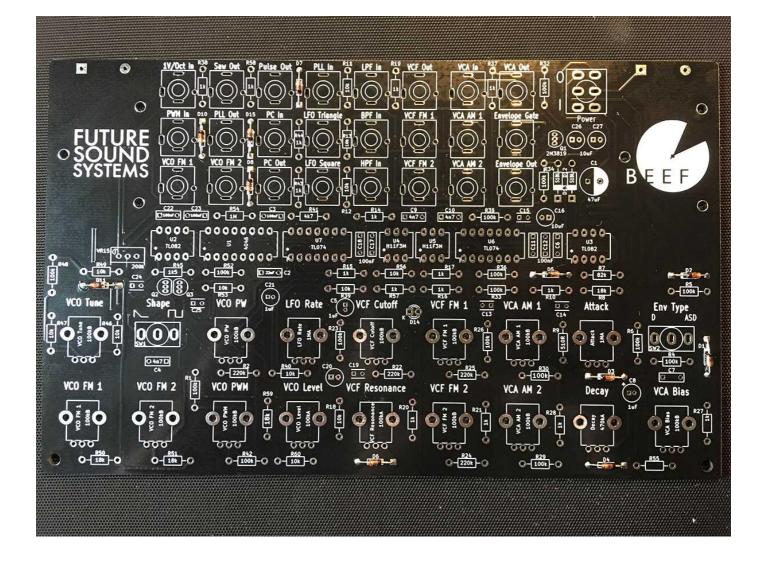

02 - First place and solder the 1N4148 diodes – Note: Orientation is vital! Be sure to match the diodes stripe with the PCB silkscreen as in the image above (D1, D2, D3, D4, D5, D6, D7, D8, D10, D11, D15)

Future Sound Systems – Brunswick Build Document V1

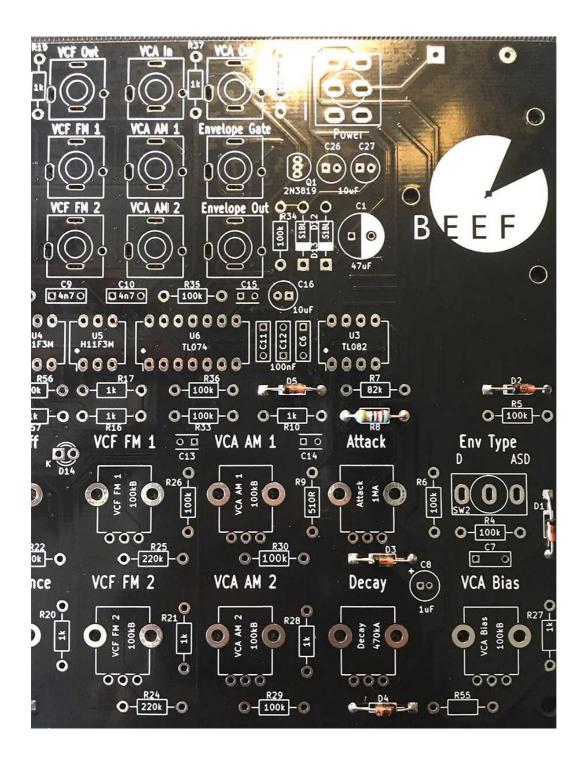


03 - Place and solder the 33k resistor at R8 – Note: IGNORE THE SILKSCREEN. THE PCB IS LABELLED 18K BUT 33K IS CORRECT

Future Sound Systems – Brunswick Build Document V1



04 - Place and solder the 100k resistors (R1, R4, R5, R6, R23, R26, R29, R30, R32, R33, R34, R35, R36, R42, R48, R52, R55)

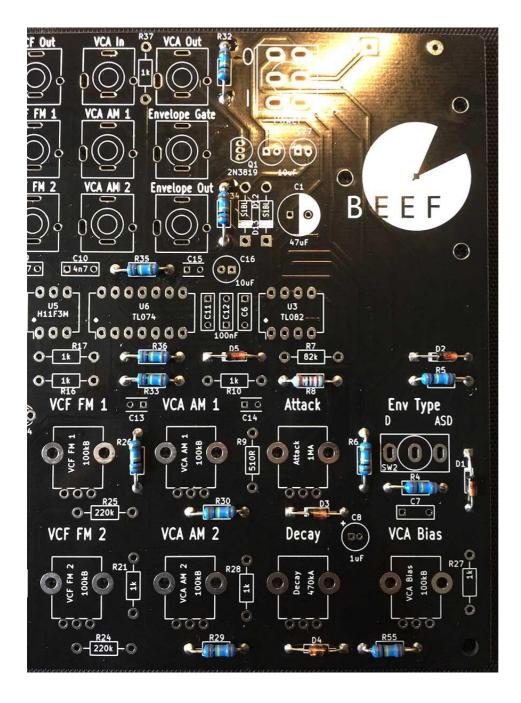

05 – Don't forget to give R55 a 100k resistor, it's located at the bottom right of the PCB




06 - Place and solder the 10k resistors (R11, R12, R13, R18, R39, R40, R46, R47, R49, R53, R56, R60)

Future Sound Systems – Brunswick Build Document V1




07 - Place and solder the 4k7 resistor at R41, located just above the leftmost TL074 (U7).

Future Sound Systems – Brunswick Build Document V1

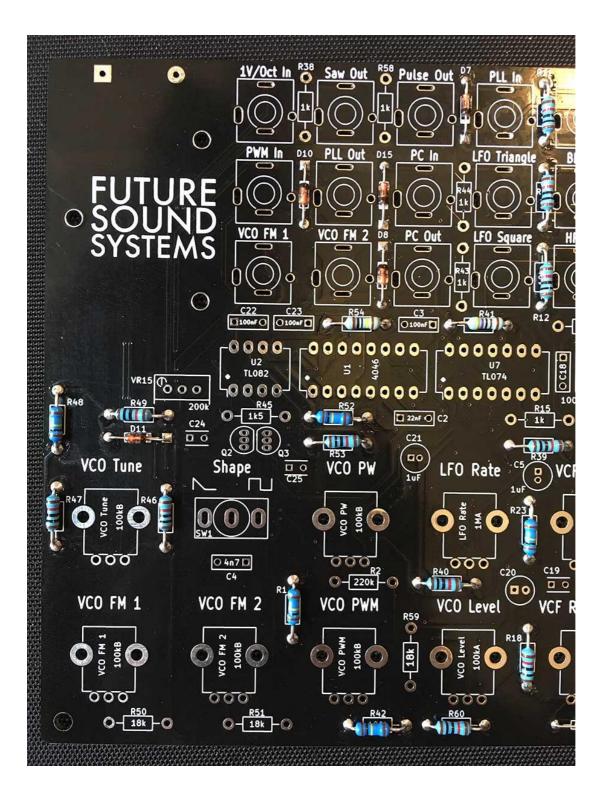


08 - Place and solder the 1M resistor at R54, located just above the 4046 (U1)

Future Sound Systems – Brunswick Build Document V1

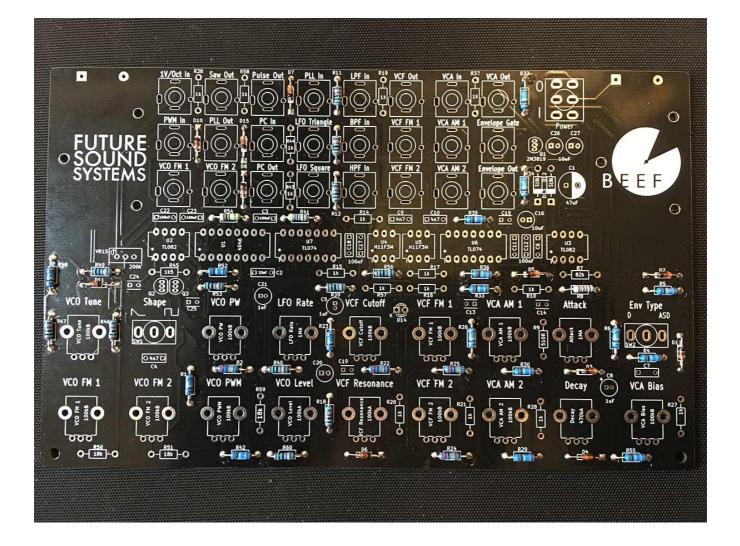


09 - Place and solder the 220k resistors (R2, R22, R24, R25)

Future Sound Systems – Brunswick Build Document V1

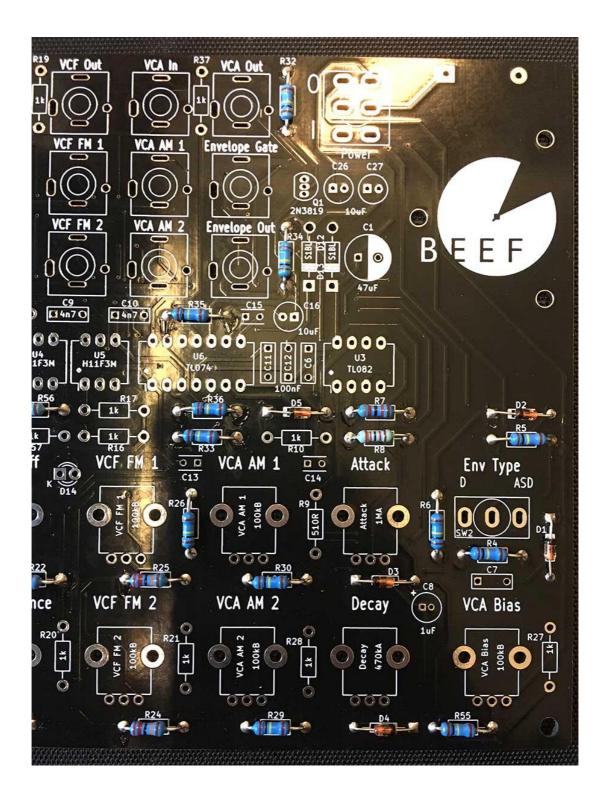


10 - Place and solder the 82k resistor at R7, located just below the rightmost TL082 (U3)

Future Sound Systems – Brunswick Build Document V1

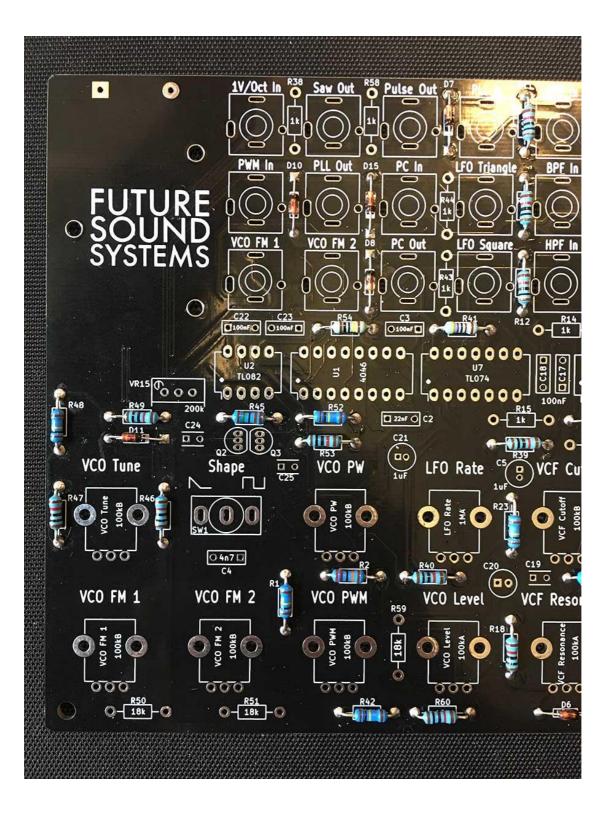


11 - Place and solder the 1k5 resistor at R45, this is located just below the leftmost TL082 (U2)

Future Sound Systems – Brunswick Build Document V1

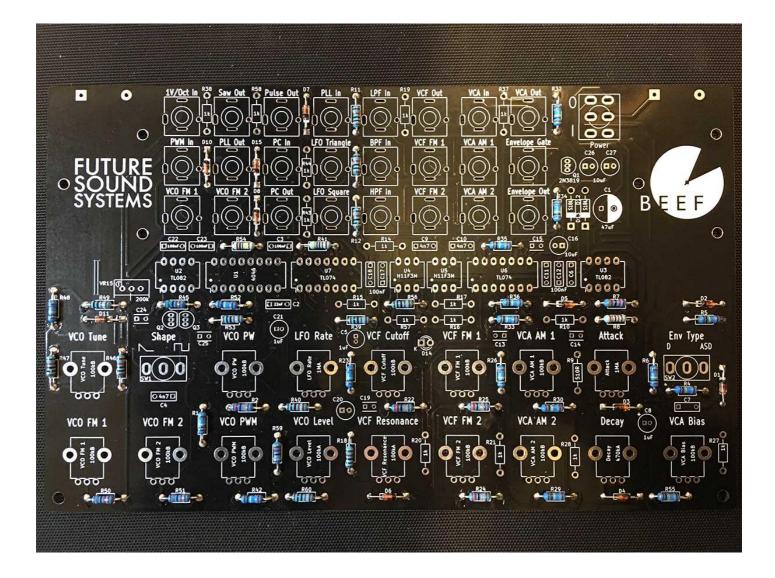


12 - Place and solder the 18k resistors (R50, R51, R59)

Future Sound Systems – Brunswick Build Document V1

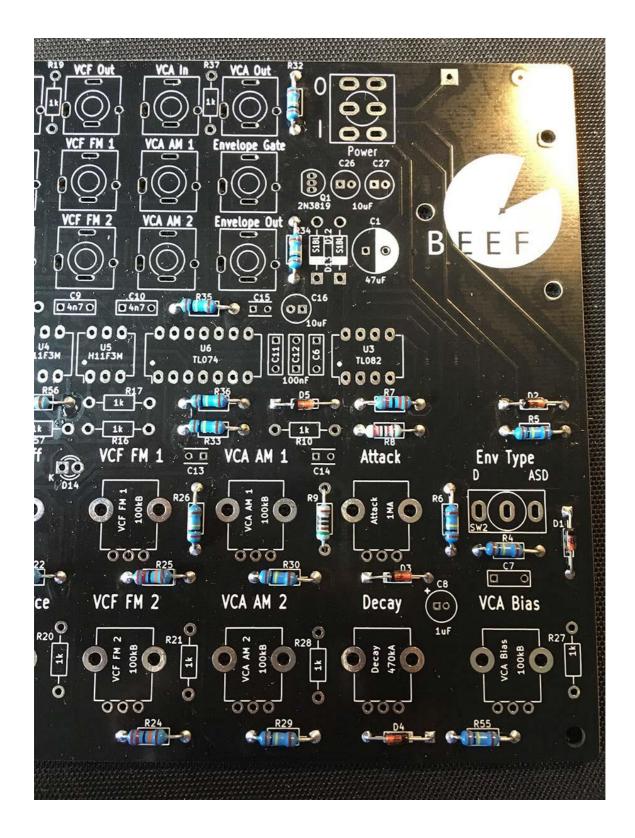

13 - Place and solder the 510R resistor at R9, located between the VCA AM 1 and Attack pots

Future Sound Systems – Brunswick Build Document V1

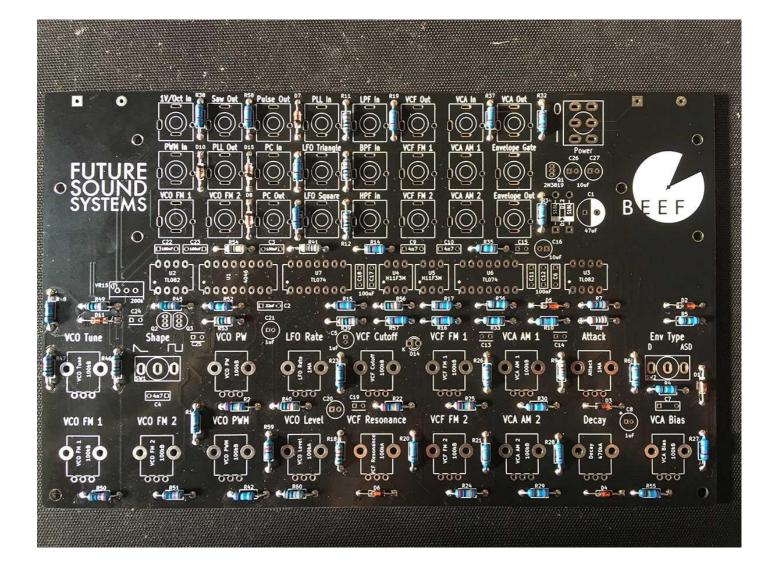


14 - Place and solder 1k resistors - these are the final resistors (R10, R14, R15, R16, R17, R19, R20, R21, R27, R28, R37, R38, R43, R44, R57)

Future Sound Systems – Brunswick Build Document V1



15 - Place and solder 2 x 1N4001 diodes (D12, D13)

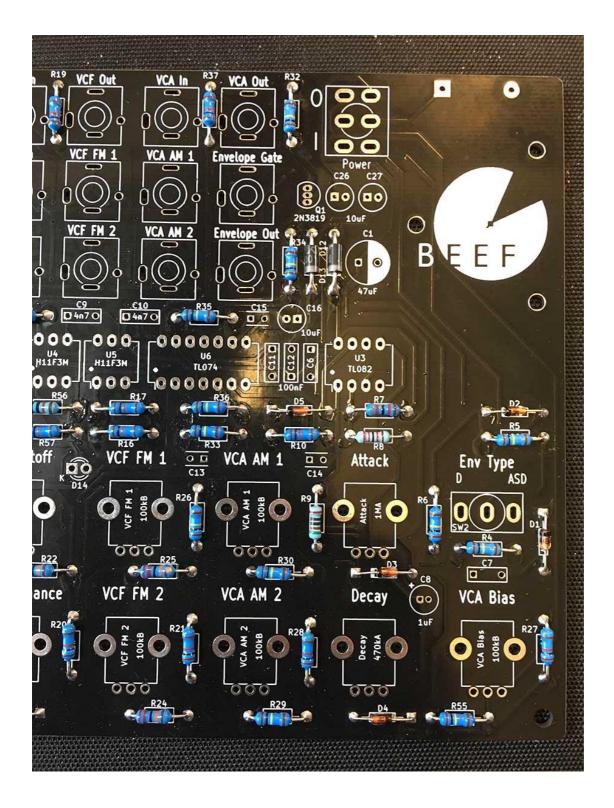

15 - Place and solder 2 x 1N4001 diodes (D12, D13) located between the 2N3819 (Q1) and rightmost TL082 (U3)

Future Sound Systems – Brunswick Build Document V1




16 - Place and solder 3 x 47pF caps at C13, C14, C15

Future Sound Systems – Brunswick Build Document V1




17 - Place and solder 2 x 100pF caps at C19 and C25

Future Sound Systems – Brunswick Build Document V1

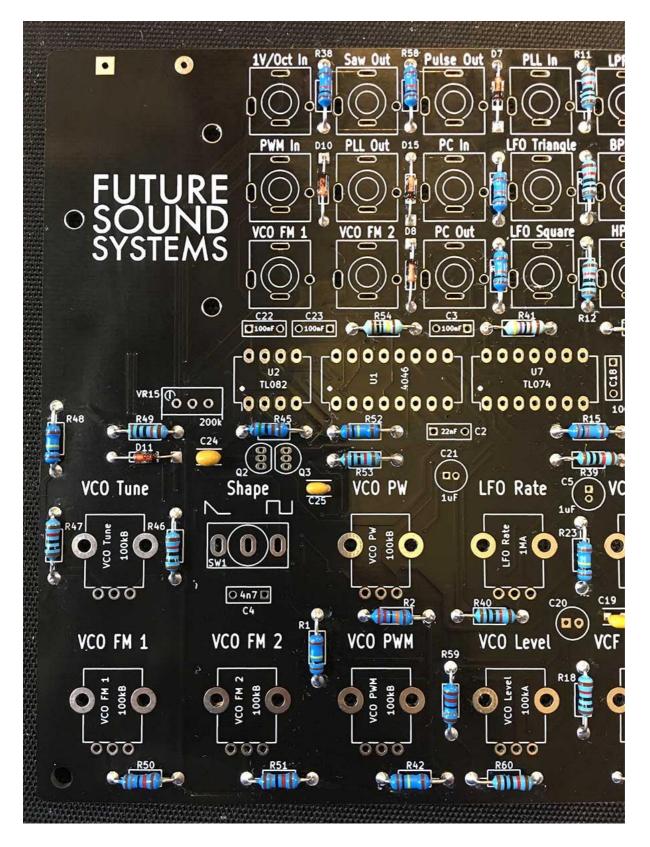


18 - Place and solder the 4.7nF CERAMIC cap at C24, located below the VR15 trimmer

Future Sound Systems – Brunswick Build Document V1

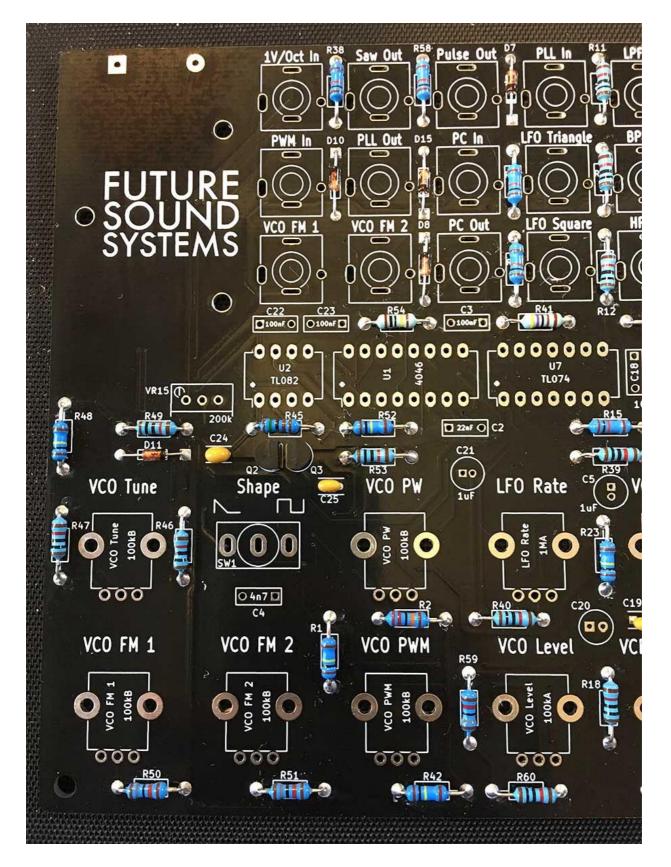


19 Now place and solder the 2 x 2N3904 transistors at Q2 and Q3 – Note: Orientation is vital! Be sure to match the curve of the transistor body with the PCB silkscreen.

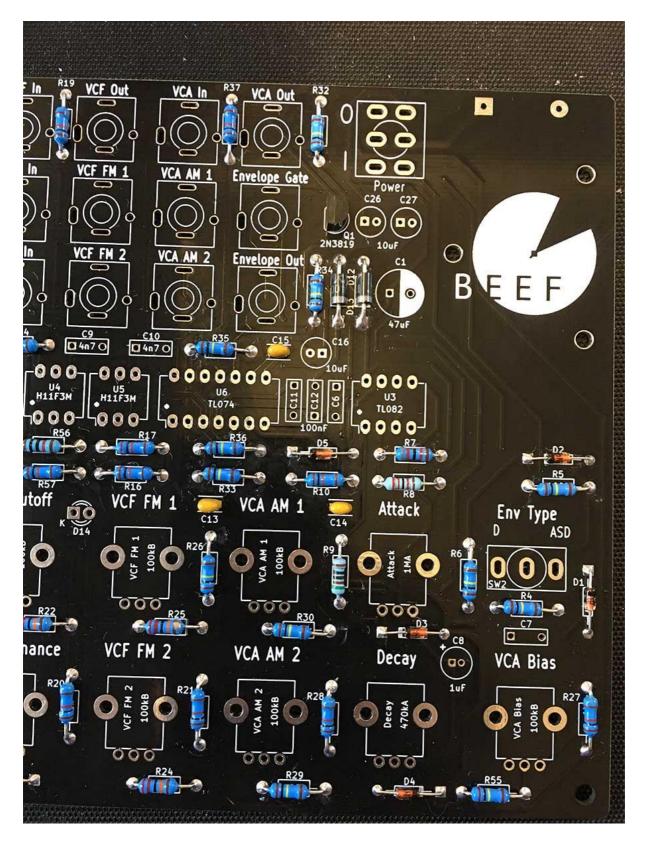


20 - Next place and solder the single 2N3819 at Q1. Note: Orientation is vital! Be sure to match the curve of the transistor body with the PCB silkscreen.

Future Sound Systems – Brunswick Build Document V1

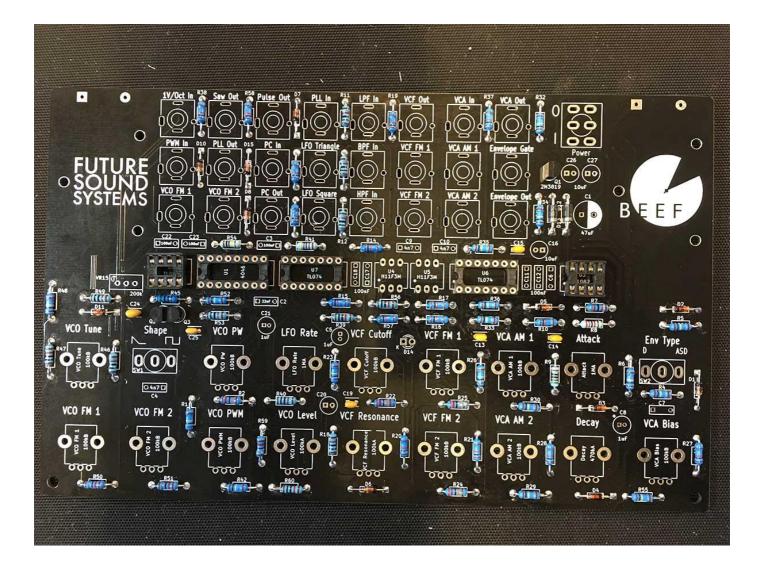


21 - Now place and solder the IC sockets. Note: Thonk kit includes 6 pin IC sockets for U4 and U5, solder these in as well. Be sure to match the notch on each socket with the dot on the PCB silkscreen.

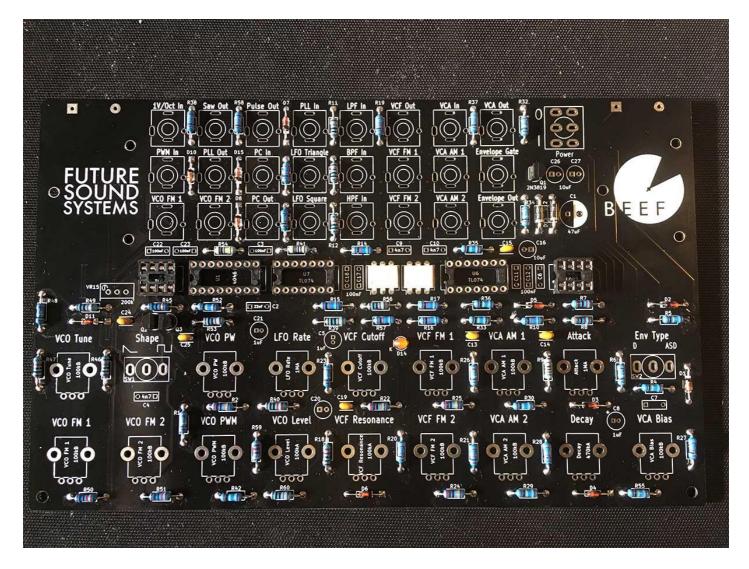


22 - Now place and solder the 3mm LED at D14. Note: Oriantation is vital! The short leg must go to the square pad labelled K

Future Sound Systems – Brunswick Build Document V1

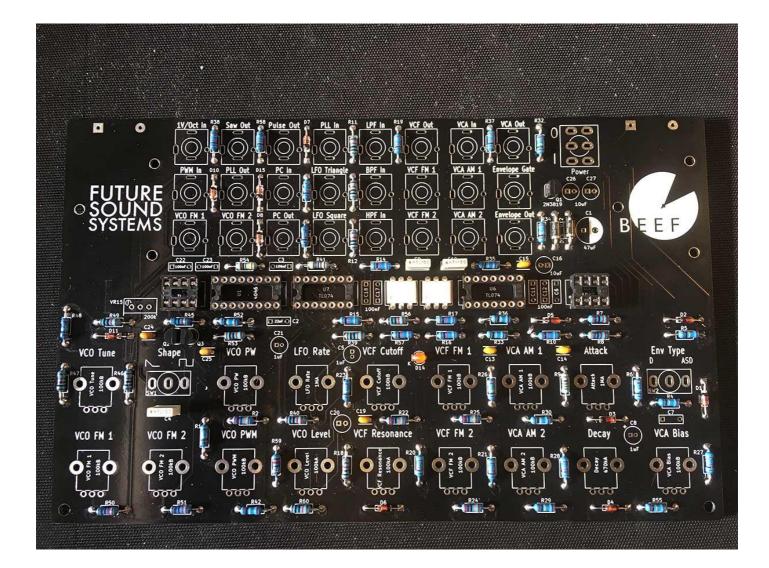


23 - Now place and solder the 3 x 4.7nF BOX caps (C4, C9, C10)

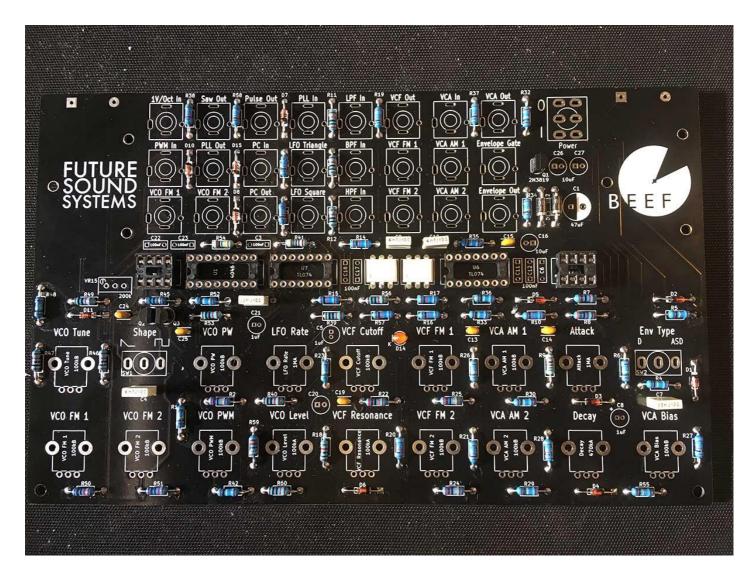


24 - Next place and solder the 2 x 22nF box caps at C2 and C7

Future Sound Systems – Brunswick Build Document V1

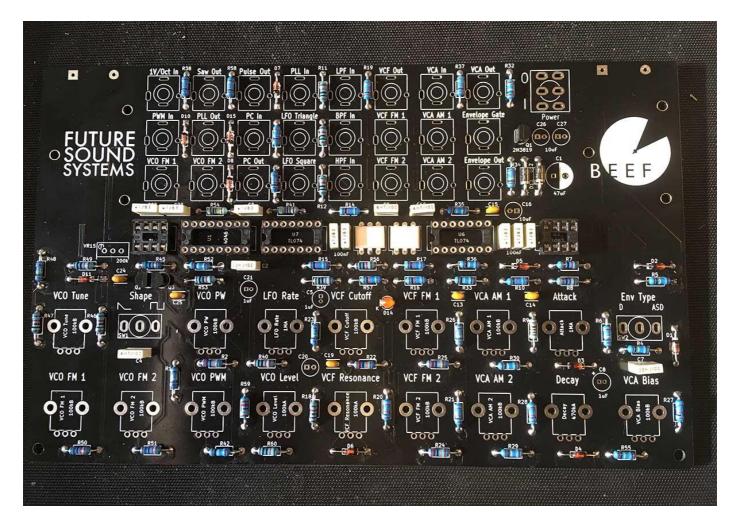


25 - Place and solder 100nF box caps at 8 the remaining box cap locations (C3, C6, C11, C12, C17, C18, C22, C23)

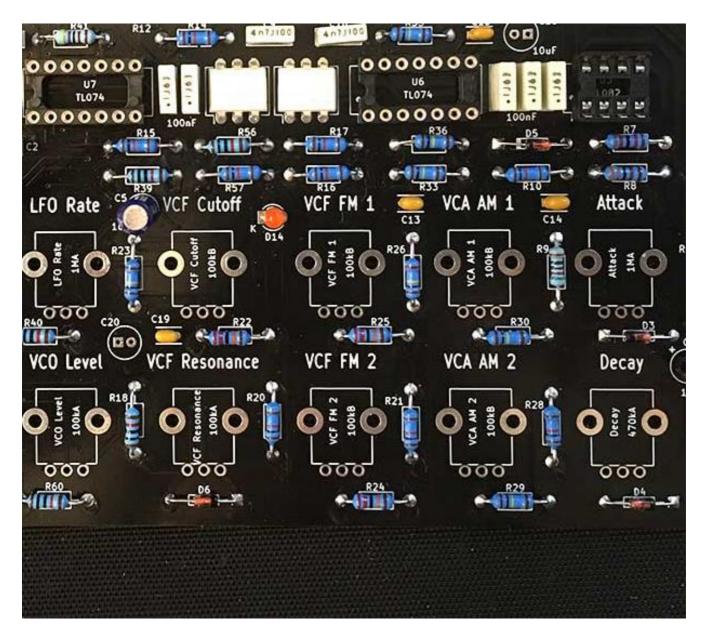

26 - Place and solder the single 2.2uF BIPOLAR cap at C5, located to the right of the LFO Rate text Note: C5 is labelled as 1uF on the PCB but 2.2uF is the correct value to use


Future Sound Systems – Brunswick Build Document V1

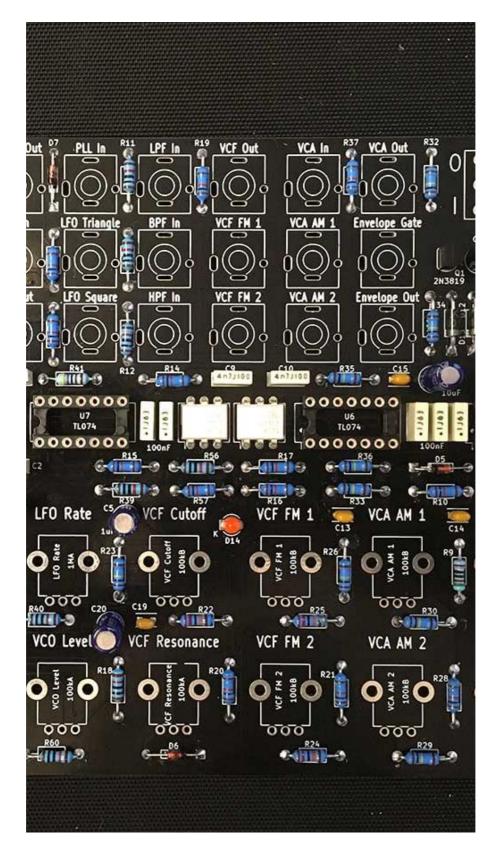

27 - Now place and solder the 2 x 10uF BIPOLAR caps at C16 and C20.jpg




28 - Now place and solder the UNIPOLAR 1uF capacitor at C8. Note: orientation is vital for UNIPOLAR caps! The longer leg must go on the side of the + on the PCB silkscreen.

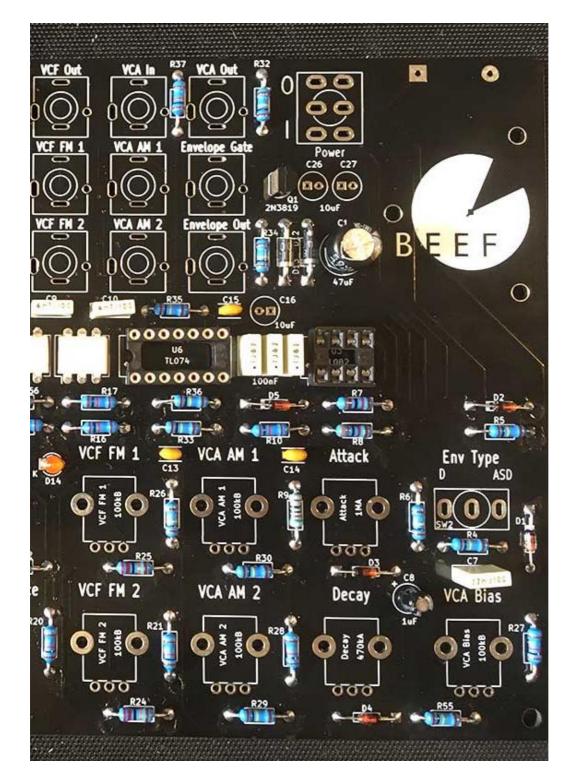


29 - Next place and solder 47uF cap at C1. Note: orientation is vital for UNIPOLAR caps! The longer leg must go to the square pad (black) the short leg to the round pad (white)

Future Sound Systems – Brunswick Build Document V1

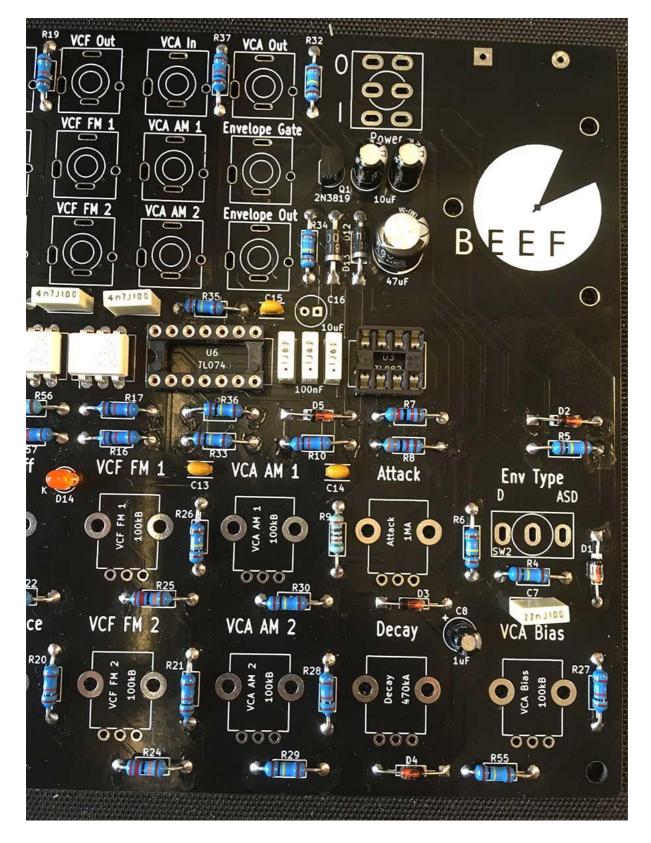


30 - Now place and solder 2 x 10uF UNIPOLAR caps at C26 and C27. Note: orientation is vital for UNIPOLAR caps! The longer leg must go to the square pad.

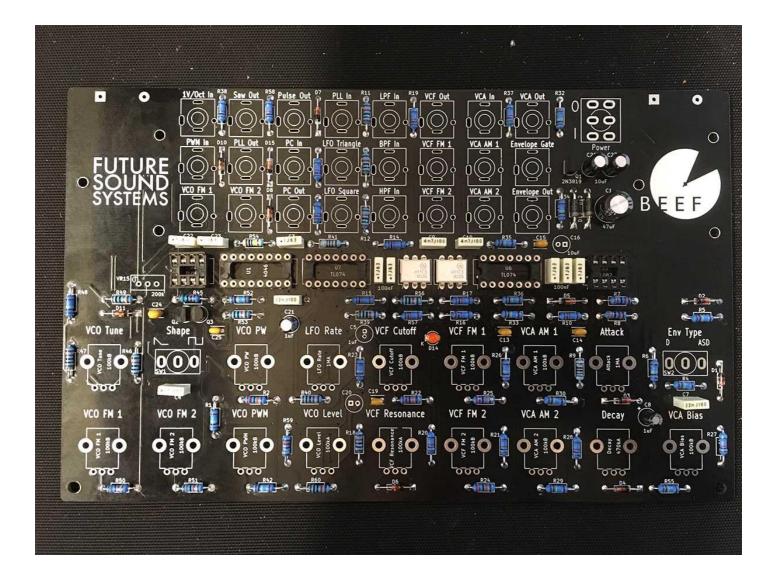


31 - Now place and solder the UNIPOLAR 2.2uF cap at C21. Note: orientation is vital for UNIPOLAR caps! The longer leg must go to the square pad.


Note: C21 PCB silkscreen is wrong - 2u2 is the correct value.

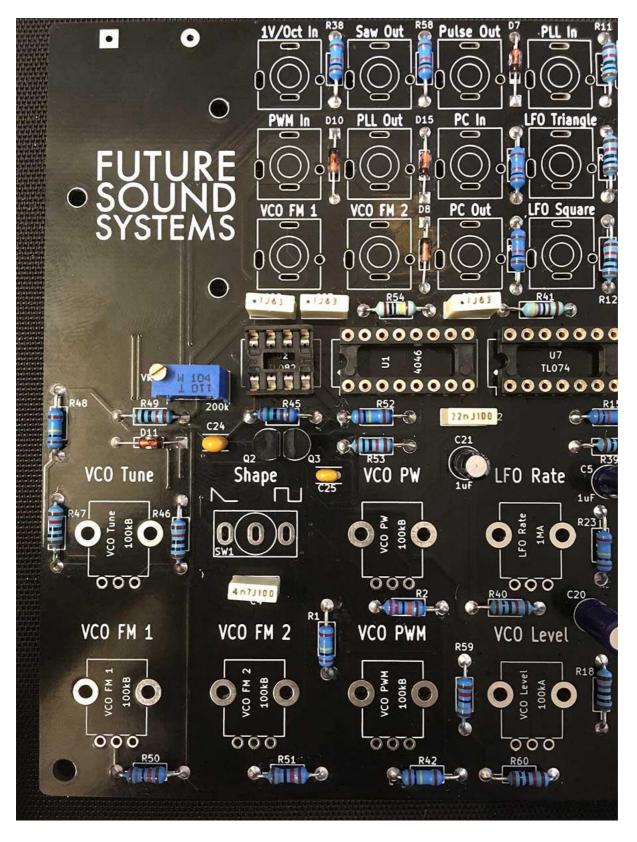

31 - Next place and solder the blue trimmer at VR15 (trimmer could be 100k or 200k as per silkscreen)

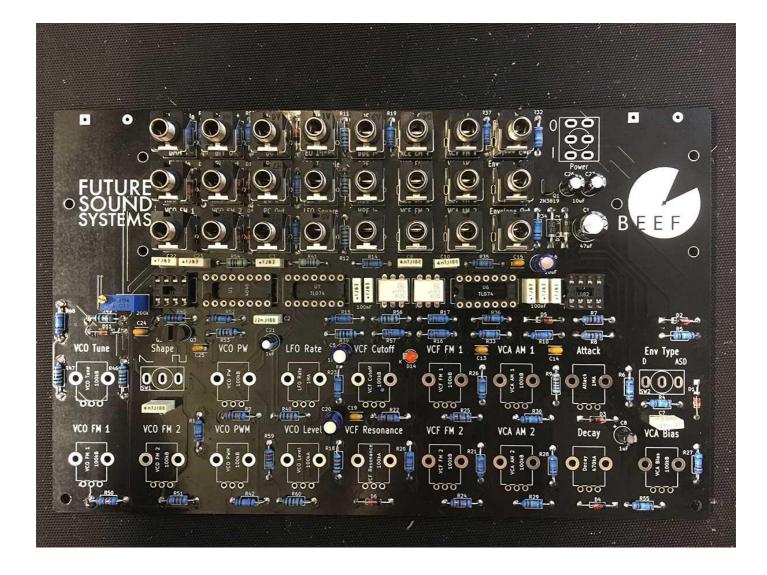


32 - Next place but DO NOT solder all 24 jacks

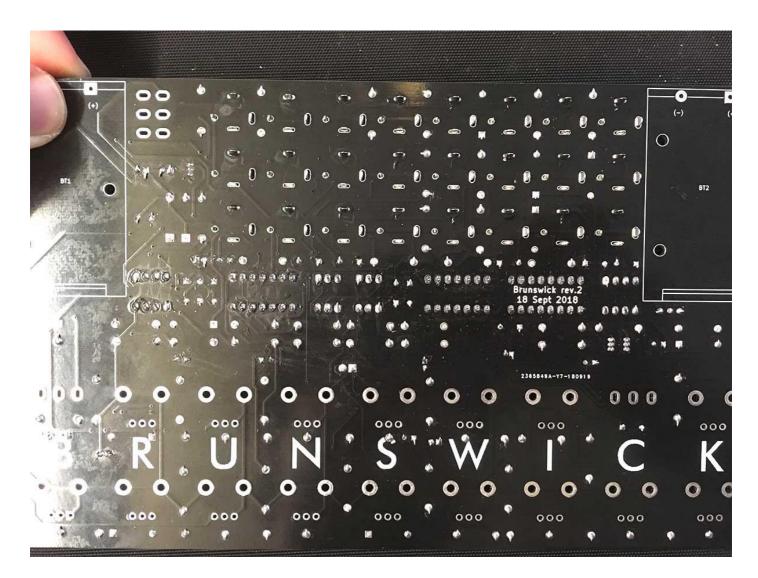


33 - Solder only the signal pin (top) lug of each jack for now – this makes them easier to desolder if there is something wrong with the build

Future Sound Systems – Brunswick Build Document V1

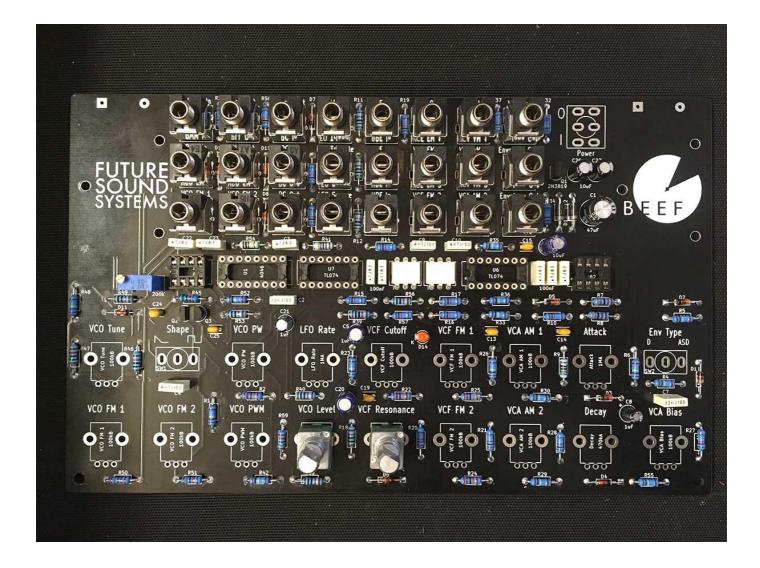


34 - Next place and solder ONLY BOTTOM THREE LEGS of A100k pots for VCO Level and VCF Res

Future Sound Systems – Brunswick Build Document V1

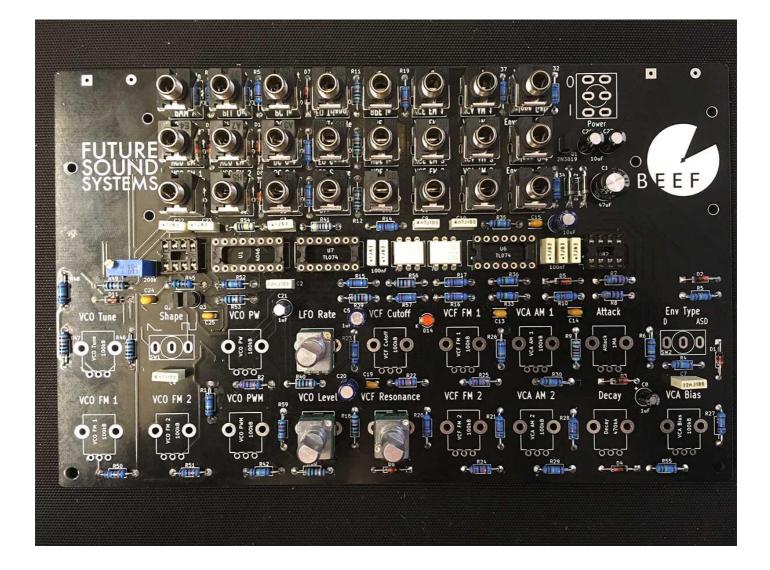


35 - Now place and solder the BOTTOM THREE LEGS of B1M pot for LFO Rate

Note: LFO Rate is labelled as A1M on the PCB, but B1M is the correct value to use

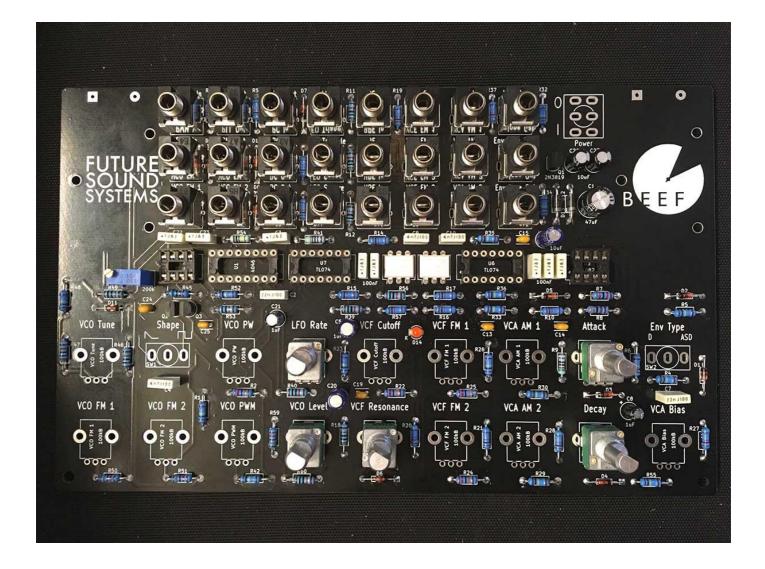


36 – Now place and solder the BOTTOM THREE LEGS of the A1M pots for Attack and Decay

Note: Decay on the PCB is labelled as A470K, but A1M is the correct value to use

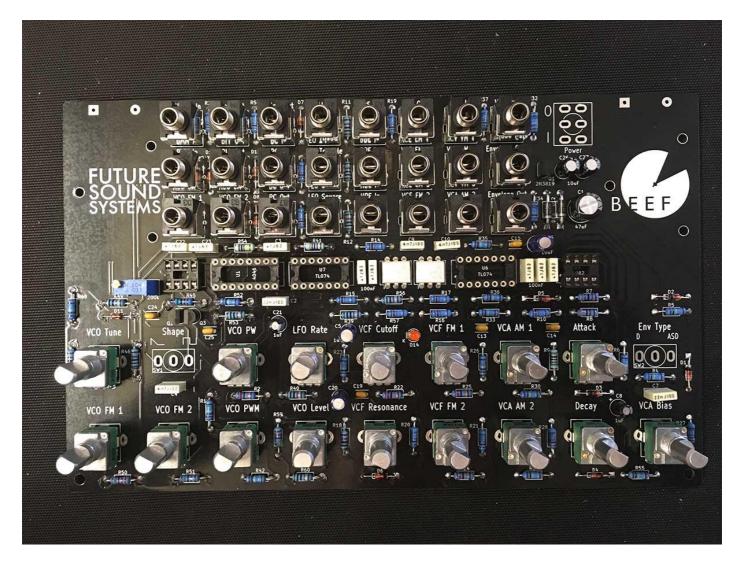


37 - Now place and solder BOTTOM THREE LEGS for the 11 x B100K pots for all other pot locations

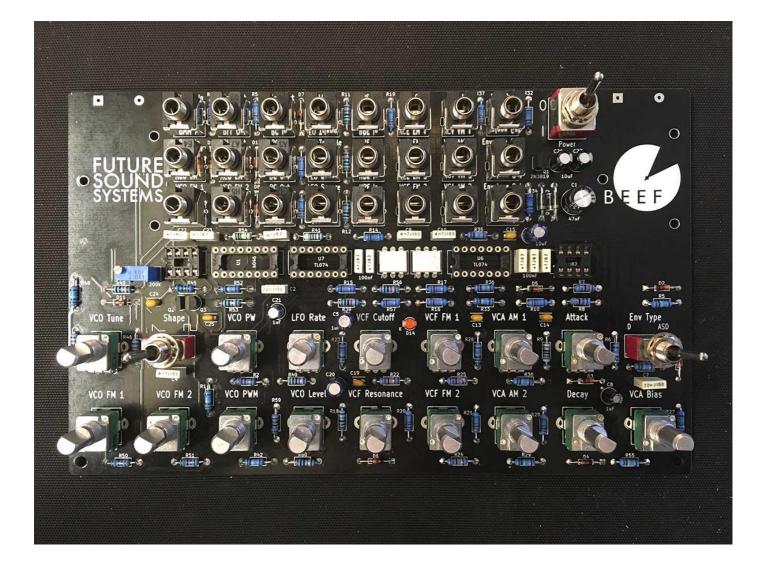


38 - Now place and solder 2 x SPDT switches and 1 x DPDT switch - ensure they sit as flat as possible against PCB



39 – Now take both battery holders and carefully bend the pins slightly towards the nearest edge

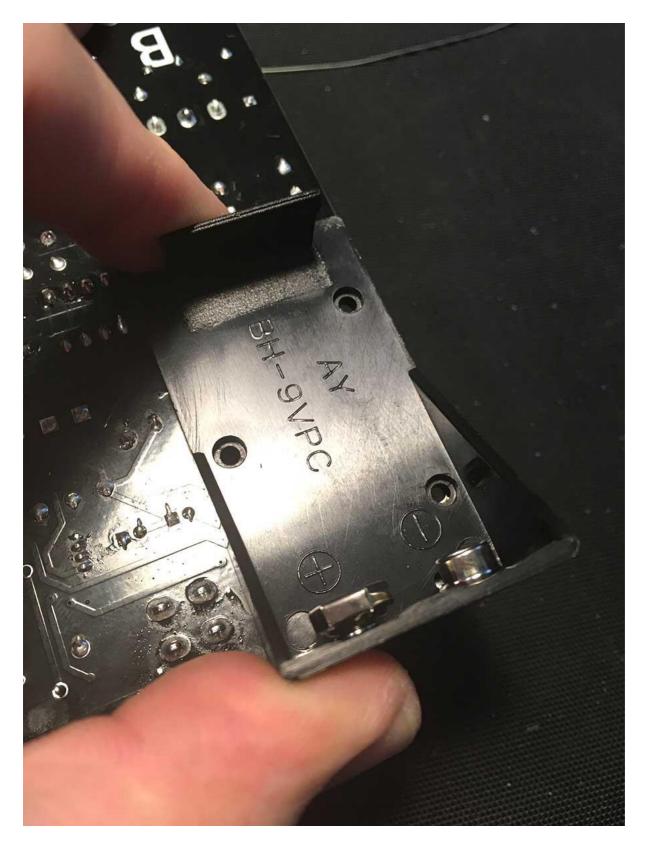

40 - Fit the battery holder to the back of the PCB - ensuring that mounting holes line up as well as possible

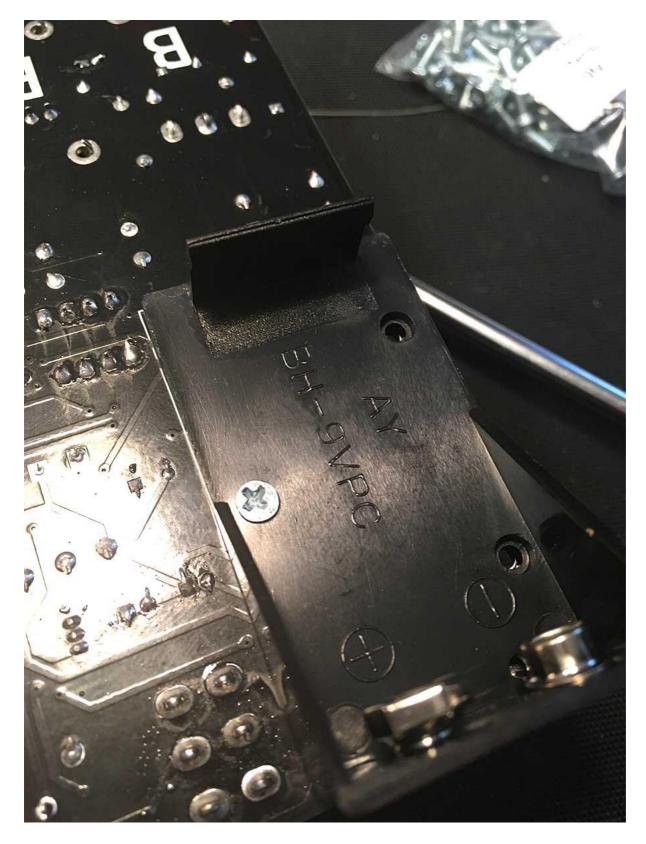

41 - Now fit an M2.5 screw to one hole to secure - you may have to thread through the PCB pad




42 - The top side of the PCB should still look good once threaded

Future Sound Systems – Brunswick Build Document V1




43 - Now fit the two remaining screws into each battery holder


Future Sound Systems – Brunswick Build Document V1

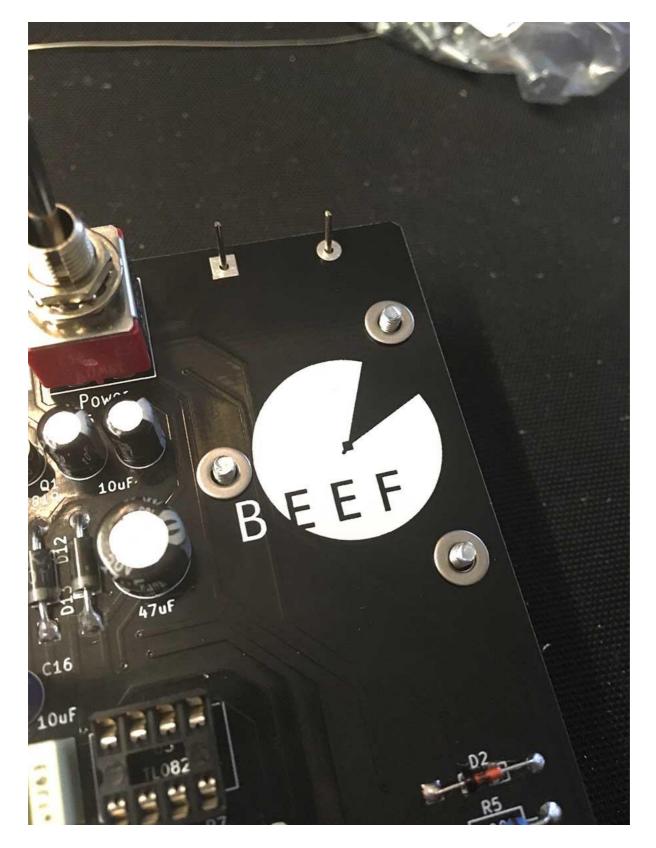

44 – Now add the M2.5 washers to each screw on the front side of the PCB. Thonk kit washers may be plastic.

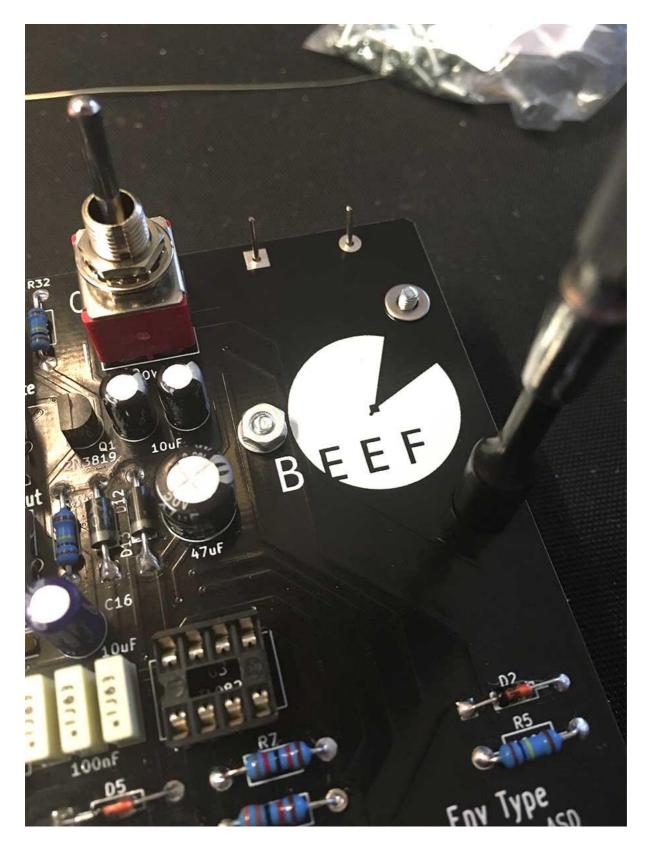

45 - Now you can fit the M2.5 nuts to each screw - a nut driver can make this easier

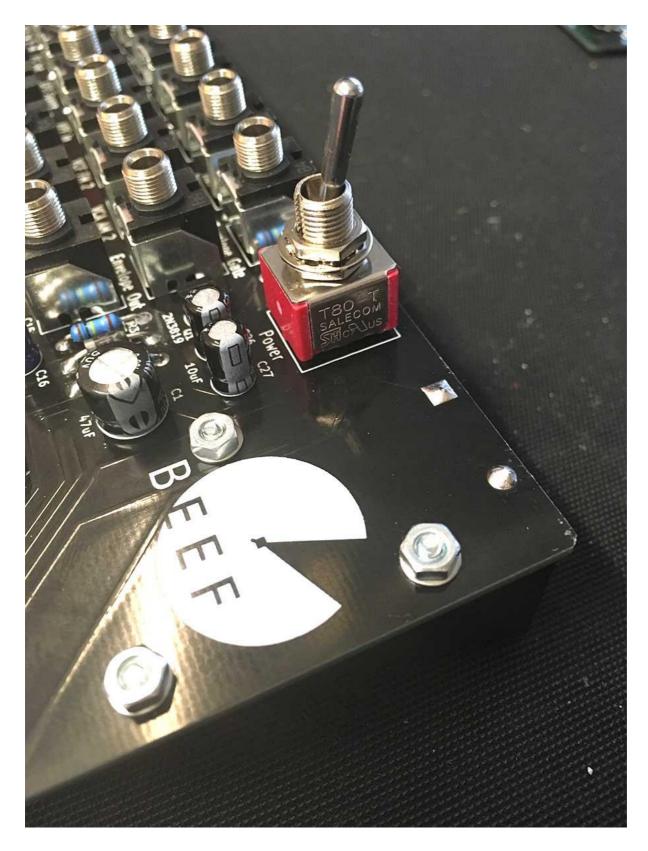

46 - Now solder the battery holder leads and snip off the excess the legs

Future Sound Systems – Brunswick Build Document V1



47 - Once soldered the battery holders should look as in the picture above

Future Sound Systems – Brunswick Build Document V1



48 - Now paying attention to orientation, fit the ICs to their sockets as shown and fit batteries

Note: Orientation is vital for all IC's

Future Sound Systems – Brunswick Build Document V1



49 - Once you have tested that your build works, you can solder all the remaining legs on the jacks and pots, and then fit the knob caps